APTech
ADVANCED PRESSURE TECHNOLOGY

SERIES AP 30, 35 & 36

1/4 INCH DIAPHRAGM VALVE

Springless – manual and pneumatic (NC & NO)

- Replaceable seat
- Stainless steel 316L VAR secondary remelt or Ni-Cr-Mo alloy construction
- Operating pressures from 125 psig (9 bar) to 3,000 psig (207 bar)
- LOTO and indicating switch options
- Flow capacity 0.23 to 0.29 C_V
- Surface finish 15 Ra max/10 Ra avg (10, 7 & 5 Ra max options)
- FA option 1.125 inch C-seal
- Constant bleed option 5, 8 and 15 slpm of N2 @ 80 psig (5.5 bar) refer to PN 430
- Multi-port options available (refer to page 4)
- Two step pneumatic valve option: dual operation – metered or full open
- Installation and operating instructions available at www.aptech-online.com in the Tech Briefs section

Manual valves

	PSIG / BAR 250 / 17	300 / 21	3,000 / 207
AP 3600 – Round knob, multi-turn			●
AP 3625 – Lever valve, 1/4 turn – LOTO, PL 225 optional – Lever position indicates valve status			●
AP 3625FA – 1.125 inch C-seal – LOTO, PL 226 optional		●	
AP 3650 – Round knob, 1/4 turn – Open/closed status indication window – Switch option for remote monitoring			●
AP 3652 – Round knob, 1/4 turn – Open/closed status indication window – Unique design combines scalloped round knob with raised rectangular section	●		
AP 3657 and 3659 – Round knob, 1/4 turn – Pull, then turn to open – safety feature – Open/closed status indication window – LOTO – integral standard feature	● AP 3659		● AP 3657

Pneumatic valves, normally closed (NC)

	PSIG / BAR 125 / 9	145 / 10	300 / 21	3,000 / 207
AP 3000 and 3002 – Switch option for remote monitoring				●
AP 3540		●		
AP 3540VS, 3542, 3545FA	●			
AP 3550 – Switch option for remote monitoring			●	
AP 3571 – Dual mode – metered or full open	●			

Pneumatic valve, normally open (NO)

	PSIG / BAR 125 / 9	250 / 17	3,000 / 207
AP 3080 – Switch option for remote monitoring			●
AP 3580 – Switch option for remote monitoring		●	
AP 3585FA	●		

All specifications subject to change without notice.

ENGINEERING DATA — SERIES AP 30, 35 & 36 1/4 INCH VALVE ARRAY

Engineering Data — Manual valves

Operating pressure	AP 3652, 3659	Vacuum to 250 psig (17 bar)
	AP 3625FA	Vacuum to 300 psig (21 bar)
	AP 3600, 3625, 3650, 3657	Vacuum to 3,000 psig (207 bar)
Flow coefficient (C_V)	AP 3600, 3625, 3650, 3652, 3657, 3659	0.29 (X_T = 0.6)

Engineering Data — Pneumatic valves

Operating pressure	AP 3540VS, 3542, 3571, 3545, 3585	Vacuum to 125 psig (9 bar)
	AP 3540	Vacuum to 145 psig (10 bar)
	AP 3580	Vacuum to 250 psig (17 bar)
	AP 3550	Vacuum to 300 psig (21 bar)
	AP 3000, 3002, 3080	Vacuum to 3,000 psig (207 bar)
Flow coefficient (C_V)	AP 3000, 3080	0.23 (X_T = 0.5)
	AP 3002	0.28 (X_T = 0.5)
	AP 3540, 3542, 3545, 3550, 3571,	0.29 (X_T = 0.6)
	AP 3580, 3585	0.29 (X_T = 0.6)
Status	AP 3000, 3002, 3540, 3542, 3545	Normally closed (NC)
	AP 3550, 3571	Normally closed (NC)
	AP 3080, 3580, 3585	Normally open (NO)
Actuation pressure	AP 3000, 3002, 3540, 3550	70 to 110 psig (5 to 8 bar)
	AP 3080, 3545, 3571, 3580, 3585	70 to 110 psig (5 to 8 bar)
	AP 3542	60 to 110 psig (4 to 8 bar)
Actuation port	AP 3000, 3002, 3080, 3540, 3545,	1/8 NPT, top port
	AP 3580, 3585	1/8 NPT, top port
	AP 3542	M5 top port
	AP 3550, 3571	M5 side port

Engineering Data — Other parameters all valves

Inlet and outlet connectors	1/4 and 3/8 inch face seal or tube weld, FA 1.125 inch C-seal
Internal volume	0.06 in^3 (1.07 cm^3)
Operating temperature	-40° to +160° F (-40° to 71° C)*
Surface finish	15 µin. Ra max / 10 µin. Ra avg. (0.4/0.25 µm) standard; 10 µin (0.25 µm); 7 µin (0.18 µm); and 5 µin (0.13 µm) Ra max optional
Proof pressure	150% of operating pressures
Burst pressure	300% of operating pressures
Inboard leakage	2 x 10^{-10} sccs
Outboard leakage	2 x 10^{-9} sccs He
Leakage across seat	1 x 10^{-9} sccs He

Engineering Data — Wetted materials all valves

	S	**H** (not available FA)
Body	SS 316L secondary remelt	Ni-Cr-Mo alloy / UNS N06022
Finish	Electropolished and passivated	Electropolished
Diaphragm	Ni-Co Alloy / UNS R30003	Ni-Co Alloy / UNS R30003
Seat	PCTFE (Polyimide optional)	PCTFE

AP 3571 — Metered flow range tolerance at 80 psig N_2 inlet, 0 psig outlet

10 to 20 slpm	+/- 6 slpm
21 to 50 slpm	+/- 10 slpm
51 to 100 slpm	+/- 15 slpm
101 to 200 slpm	+/- 20 slpm

*VS option 14° to 194°F (-10° to + 90°C).

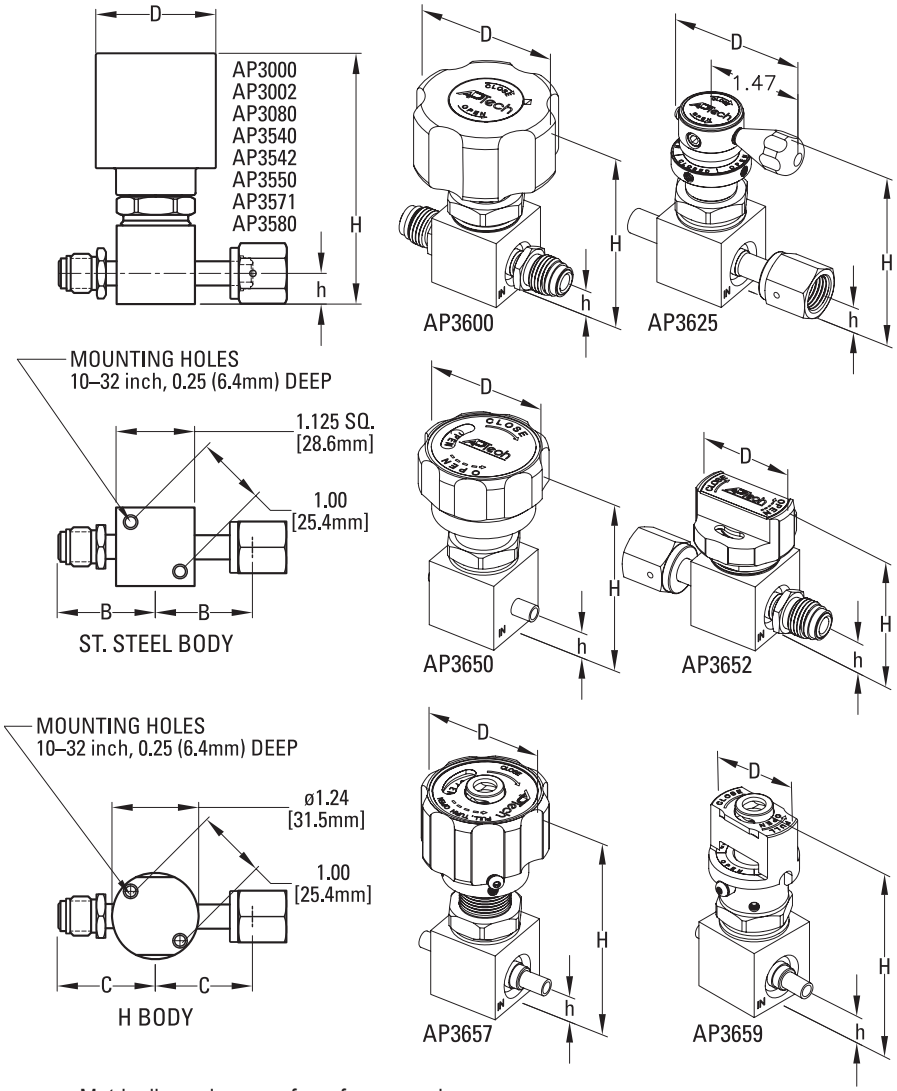

- Metric dimensions are for reference only.
- Height of the valve (H) is an approximate value.
- All specifications subject to change without notice.
- All manual valves are shown in open position.

FA – 1.125 inch C-seal

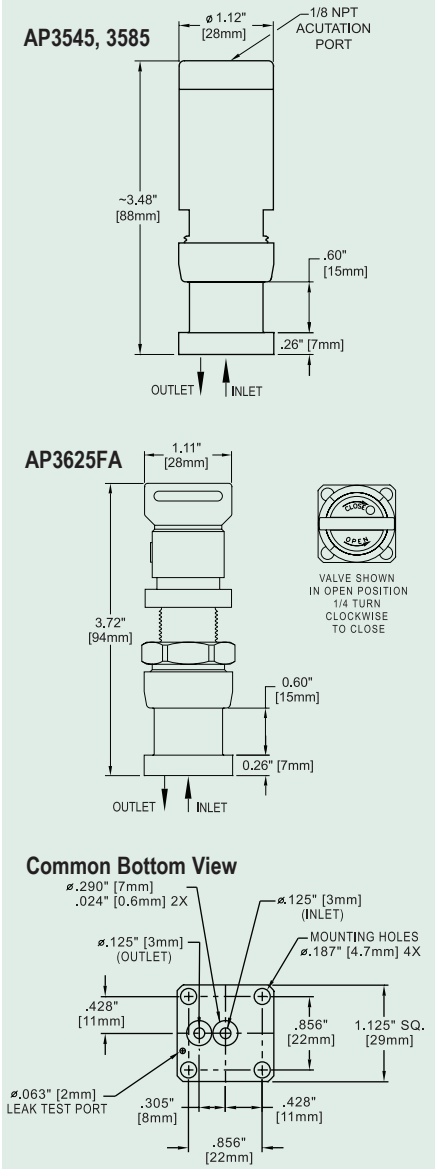

VALVE	D		H	
	inch	mm	inch	mm
AP3000	ø1.98	50.3	~4.10	104
AP3002	ø1.98	50.3	~4.10	104
AP3080	ø1.98	50.3	~4.89	124
AP3540	ø1.46	37.1	~3.49	89
AP3542	ø1.57	40.0	~2.24	57
AP3550	ø1.37	34.8	~3.28	83
AP3571	ø1.72	43.7	~3.63	92
AP3580	ø1.46	37.1	~3.17	81
AP3600	ø2.12	53.8	~3.00	76
AP3625	2.04	51.8	~2.94	75
AP3650	ø1.87	47.5	~3.02	77
AP3652	ø1.50	38.0	~2.17	55
AP3657	ø1.87	47.5	~3.60	91
AP3659	ø1.30	33.0	~3.13	80

STAINLESS STEEL BODY				
CONNECTION	B		h	
	inch	mm	inch	mm
FV4, MV4	1.390 ±.010	35.3	0.44	11.2
TW4	1.060 ±.010	26.9	0.44	11.2
FV6, MV6	1.930 ±.010	49.0	0.44	11.2
TW6	1.325 ±.010	33.7	0.44	11.2

H BODY				
CONNECTION	C		h	
	inch	mm	inch	mm
FV4, MV4	1.450 ±.010	36.8	0.44	11.2
TW4	1.080 ±.010	27.4	0.44	11.2
FV6, MV6	1.930 ±.010	49.0	0.44	11.2
TW6	1.325 ±.010	33.7	0.44	11.2

ULTRACLEAN TECHNOLOGY BACKED BY SERVICE AND SUPPORT

PORTING CONFIGURATIONS

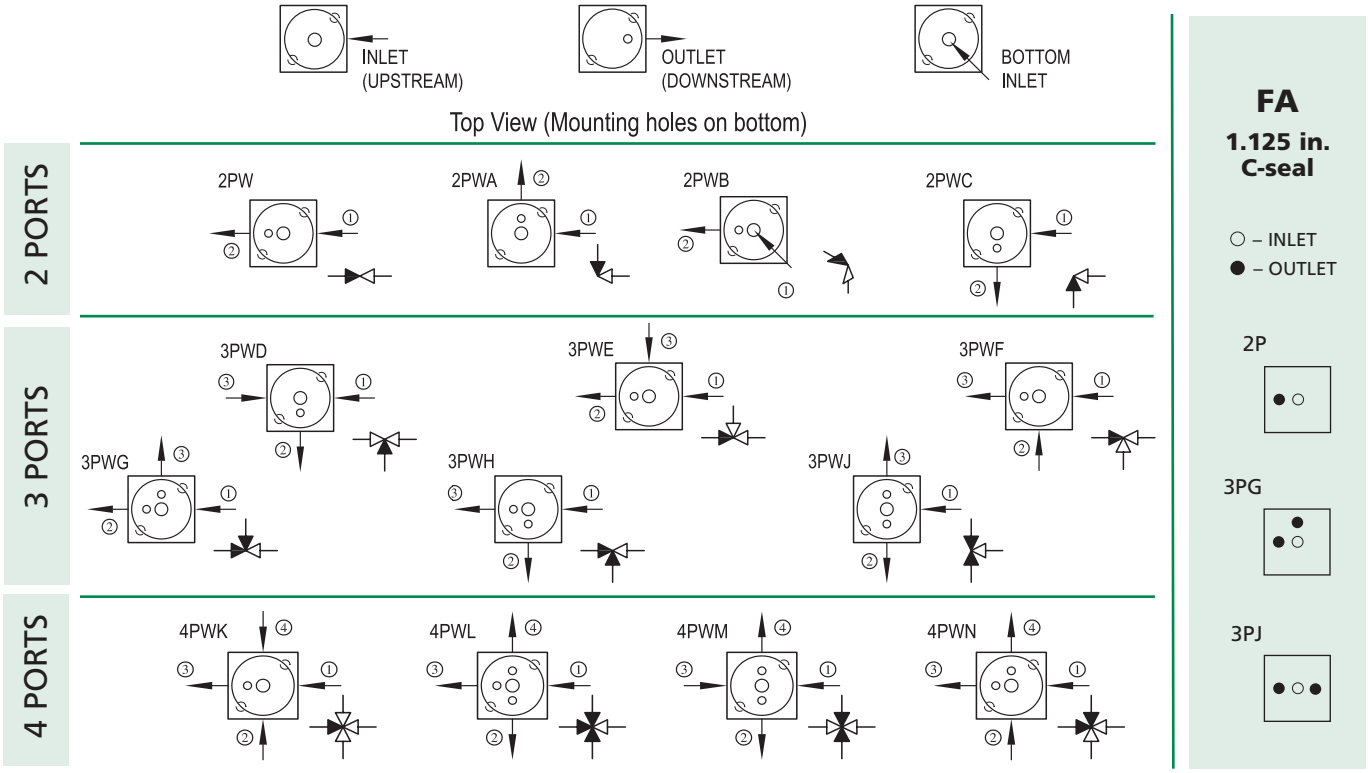

- Valves are illustrated top view looking down through the valve. Mounting holes on the valve bottom are shown for reference.
- INLET (Upstream) is defined as a port connected to the region below the valve seat. It is illustrated with an arrow pointing towards the valve body or an "empty" triangle on the schematic. OUTLET (Downstream) is defined as a port connected to the region above the seat and below the diaphragm. It is illustrated with an arrow pointing away from the valve body or a "filled" triangle on the schematic.
- The traditional flow direction is INLET to OUTLET, but AP Tech valves may be employed in either flow direction.
- End connections are specified in numerical order per the diagram's numbered arrows.

CAUTION: Product selection is the sole responsibility of the user, regardless of any recommendations or suggestions made by the factory. The user shall make selections based upon their own analysis and testing with regard to function, material compatibility and product ratings. Proper installation, operation and maintenance are also required to assure safe, trouble free performance.

ORDERING INFORMATION

Sample Order Number — **AP 3652S 2PW MV4 MV4** (C-seal Example: AP 3545S 2P FA)

AP 3652 | Series

AP 3000, 3002, 3080, 3540, 3542
AP 3545, 3550, 3571, 3580, 3585
AP 3600, 3625, 3650, 3652, 3657, 3659

S | Material

S = Stainless steel (SS)
H = Ni-Cr-Mo alloy (not available FA).

Surface Finish Options

M = 10 µin. Ra max
V = 7 µin. Ra max
X = 5 µin. Ra max

2PW | Ports

2PW = 2 ports welded
3PW = 3 ports welded
4PW = 4 ports welded

Porting Designation Option

X = Letter code for available porting option
Refer to porting options above.

MV4 MV4 | Connections Inlet / Outlet or ① ② ③ ④

FV4 = 1/4 inch face seal female
MV4 = 1/4 inch face seal male
TW4 = 1/4 inch tube stub weld
FV6 = 3/8 inch face seal female
MV6 = 3/8 inch face seal male
TW6 = 3/8 inch tube stub weld
Refer to chart on page 3 for available connections.

Options

1.75 = 1.75" face to face TW4, TW6*
VS = Polyimide Seat
P = Panel mount, manual valves** (except 3652, 3659, 4659 & FA)
ISC = Indicating switch, NC** (AP 3550 & 3580 only)
ISO = Indicating switch, NO** (AP 3550 & 3580 only)
IS = Indicating switch** (AP 3000, 3002 & 3080 only)
ISH = Indicating switch** (AP 3650 only)
MXXX*** = 3571 metered adjusts flow in slpm at 80 psig N_2
FA = 1.125 inch C-seal****
SC = Short bonnet

*AP 3542 has limited clearance for orbital weld head.

**Refer to manual for installation information.

***NOTE: Replace XXX with flow rate using 3 digits, example 50 slpm = M050.

****FA available 3625, 3545 and 3585.

AP Tech has product options and variations which are not documented in data sheets. If you have a model number that is not defined by the ordering information, please consult the factory or your local representative.